



**THE DATASHEET OF
C8051F530A-ITR**





July 11, 2011

C8051F52xA-53xA and C8051F52x-F53x Errata

Errata Status Summary

This document summarizes all known errata with these devices.

Errata #	Title	Impact	'F52xA-53xA (Rev. B) 'F52x-53x (Rev. A)	'F52xA-53xA (Rev. C)
1	Oscillator Wakeup	Minor	Issue exists	Issue to be fixed
2	Cold Programming Temperature on industrial grade (-I) parts only.	Minor	Issue exists	Issue exists
3	Long-reset Oscillator Lockup	Minor	Issue resolved from date code "1124"	Issue to be fixed

Impact Definition: Each erratum is marked with an impact, as defined below:

- Minor—Workaround exists.
- Major—Errata that do not conform to the data sheet or standard.
- Information—The device behavior is not ideal but acceptable. Typically, the data sheet will be changed to match the device behavior.

Errata Details

1. **Description:** When a device enters a low power suspend mode by setting the SUSPEND bit in OSCICN, there is a low probability of the device remaining in suspend even when a wake-up condition is triggered.

Impact: The device remains in suspend mode until a power-on reset.

Workaround: To prevent the issue, set the ZTCEN bit in REF0CN to 1 before entering suspend mode. This will slightly increase the supply current in suspend mode but it will prevent the issue.

Resolution: Revision C of the device will not require setting ZTCEN before entering suspend mode.

2. **Description:** For -I (Industrial Grade) parts, a cold temperature programming deficiency may be present on weak flash memory bits. There is no problem programming the flash at 0 °C and above. There is only a potential flash read issue if programming was done at cold temperature below 0 °C. If programmed at 0 °C or higher, there is no problem reading flash across the entire temperature range of -40 °C to 125 °C. This errata does not apply to -A (Automotive Grade) devices.

Impacts: Flash bits programmed at temperatures below 0 °C might not read back correctly at elevated temperatures.

Workaround: Program the flash in production and in-system at 0 °C or higher. If programming must be performed at temperatures lower than 0 °C, a validation of the flash at 25 °C or greater is highly recommended.

Resolution: Silicon Labs is continuing to investigate this issue. There is no resolution at this time.

3. **Description:** If the /RST pin is held low for more than 1 second while power is applied to the device, and then /RST is released, a percentage of devices may “lock up”, and fail to execute code. Toggling the /RST pin does not clear the condition. The condition is cleared by cycling power. Most devices that are affected will show the lock up behavior only within a narrow range of temperatures (a 5 to 10 degrees C window).

Impacts: Devices that lock up due to this issue will fail to execute code until the next power-on reset.

Workaround: Ensure that the reset low time does not exceed 1 second.

Resolution: Silicon Labs has identified a solution to this problem and this solution has been tested and qualified. Parts with the fix do not have any restrictions on /RST low time. The silicon revision remains the same, but Revision B parts that implement the fix can be identified visually using the assembly date code marking on the device. A four-digit assembly build date code is marked on each part on the bottom-most line. This is in the format YYWW, where YY is the two-digit assembly build calendar year and WW is the two-digit assembly build work week. All parts that have an assembly date code of 1124 or later (year 2011, work week 24) do not have any restrictions on /RST low time.

Note: C8051F5xx products are AEC-Q100 compliant and qualification and fault coverage reports are available upon request. A list of Silicon Laboratories sales representatives can be found at www.silabs.com. The next revision of the device datasheet will include this note in the relevant sections.

Looking for pricing, stock, or lifecycle information?

Click below to explore more details on WIN SOURCE:

 [View C8051F530A-ITR](#) on WIN SOURCE

 [Silicon Labs](#) Information

Optimize Your Supply Chain with WIN SOURCE Solutions

-  Global Sourcing Solution
-  Obsolete Management
-  Cost Control Management
-  Shortage Management
-  Alternative Solution
-  Excess Inventory Management