




THE DATASHEET OF 951412-9061106-AR

3M™ Pin Strip Header

2 mm and 2 mm x 2 mm Dual Insulator, Straight, Solder Tail

951 Series

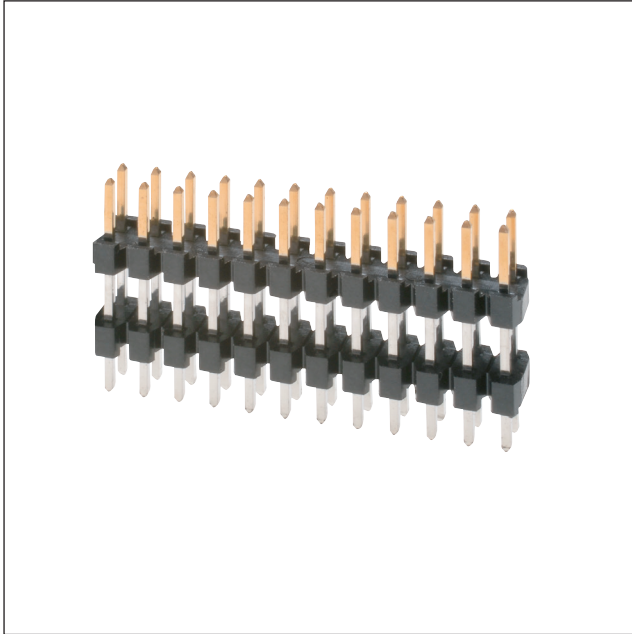

- High temperature dielectric
- “No lead” wave and reflow solder compatible
- Optimizes use of PC board space
- End stackable feature
- Side stackable feature
- RoHS Compliant. See the Regulatory Information Appendix (RIA) in the „RoHS compliance“ section of www.3Mconnectors.com for compliance information (RIA E1 & C1 apply)

Date Modified: November 27, 2012

TS-2160-C
Sheet 1 of 2

Physical

Insulation

Material: High Temperature Thermoplastic
Flammability: UL 94V-0
Color: Black

Contact

Material: Copper Alloy

Plating

Underplating: 1.25–2.5 μm [50–100 μ''] Nickel
Wiping Area: Flash Gold
Solder Tail Area: 1–3 μm [40–118 μ''] Matte Tin

Electrical

Current Rating: 1 A

Insulation Resistance: $> 5 \times 10^8$ Ohm at 100 V_{DC}

Withstanding Voltage: 1000 V_{DC}

Transition Resistance: ≤ 20 mOhm

Environmental

Temperature Range: -40 °C to +105 °C

Processing Temperature: max. 260 °C (Profile per J-STD-020C)


Moisture Sensitivity Level: 1 (per J-STD-020C)

UL File No.: E68080

3M™ Pin Strip Header

2 mm and 2 mm x 2 mm Dual Insulator, Straight, Solder Tail

951 Series

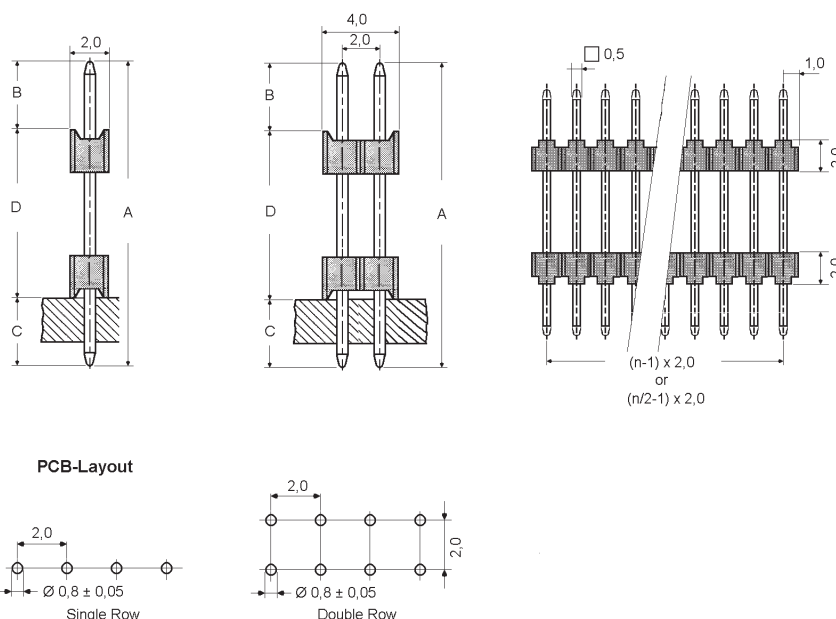

Contact Dimensions				
Coding No.	A	Mating Length B	C	D
08	10.8	4.0	2.8	4.0
11	11.9	4.0	2.8	5.1
15	14.3	4.0	2.8	7.5
19	16.5	4.0	2.8	9.7
22	18.6	4.0	2.8	11.8
25	21.2	4.0	2.8	14.4
Others on Request				

Contact Dimensions				
Coding No.	A	Mating Length B	C	D
08	12.7	5.9	2.8	4.0
11	13.8	5.9	2.8	5.1
15	16.2	5.9	2.8	7.5
19	18.4	5.9	2.8	9.7
22	20.5	5.9	2.8	11.8
25	23.1	5.9	2.8	14.4
Others on Request				

n = No. of Contacts

Tolerance Unless Noted [mm]				
Nominal Size	0.5–3	3–6	6–30	30–120
Linear Dim	+/- 0.1	+/- 0.1	+/- 0.2	+/- 0.3
Radii	+/- 0.2	+/- 0.5	+/- 1	+/- 1

Ordering Information

9514XX — XXX XX 06 — AR (RIA E1 & C1 Apply)

Contact Quantity:
02–40 Pins / 1 Row
04–80 Pins / 2 Row

Mounting Style:
8 = Solder Tail, 2 Row
9 = Solder Tail, 1 Row

Mating Pin Length
Dimension B:
01 = 4.0 mm
06 = 5.9 mm

Bord Stacking Height (D):
Coding Number: see Table

TS-2160-C
Sheet 2 of 2

Important Notice

All statements, technical information, and recommendations related to 3M's products are based on information believed to be reliable, but the accuracy or completeness is not guaranteed. Before using this product, you must evaluate it and determine if it is suitable for your intended application. You assume all risks and liability associated with such use. Any statements related to the product which are not contained in 3M's current publications, or any contrary statements contained on your purchase order shall have no force or effect unless expressly agreed upon, in writing, by an authorized officer of 3M.

Warranty; Limited Remedy; Limited Liability.

This product will be free from defects in material and manufacture for a period of ninety (90) days from the time of purchase. **3M MAKES NO OTHER WARRANTIES INCLUDING, BUT NOT LIMITED TO, ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE.** If this product is defective within the warranty period stated above, your exclusive remedy shall be, at 3M's option, to replace or repair the 3M product or refund the purchase price of the 3M product. **Except where prohibited by law, 3M will not be liable for any indirect, special, incidental or consequential loss or damage arising from this 3M product, regardless of the legal theory asserted.**



3M Electronics Solutions Division

6801 River Place Blvd.
Austin, TX 78726-9000
U.S.A.
1-800-225-5373
www.3Mconnectors.com

Please recycle. Printed in USA.
© 3M 2012. All rights reserved.
RIA-2217A-E

3M is a trademark of 3M Company.

Looking for pricing, stock, or lifecycle information?

Click below to explore more details on WIN SOURCE:

 View [951412-9061106-AR](#) on WIN SOURCE

 [3M](#) Information

Optimize Your Supply Chain with WIN SOURCE Solutions

-  Global Sourcing Solution
-  Obsolete Management
-  Cost Control Management
-  Shortage Management
-  Alternative Solution
-  Excess Inventory Management