



**THE DATASHEET OF
CC3909-000**



Molded Parts Customer Drawing

Part Number : 202D253-XX-74
ECO NO.: ECO-07-00

NOTES

- All dimensions are in $\frac{\text{inches}}{[\text{millimeters}]}$
- Dimensions appearing in table are as follows:
 a - As Supplied
 b - After Unrestricted Recovery
- Coating is optional. As supplied dimensions appearing in table are for uncoated parts. When coating is added, entry diameters will be reduced by .06 max.



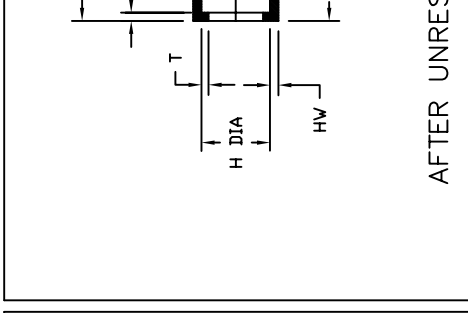


TABLE OF DIMENSIONS

PART NUMBER	H		J		P	JO	R	S	T
	Min	Max	Min	Max					
202D253-XX-74	1.47 [37,3]	1.16 [29,5]	1.47 [37,3]	.41 [10,4]	2.24 [56,9]	1.00 [25,4]	.55 [14,0]	.12 [3,0]	.065 [1,65]

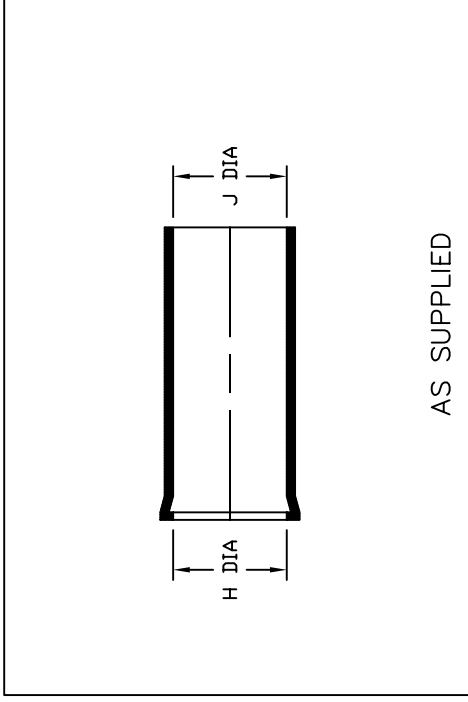

TYCO ELECTRONICS
300 CONSTITUTION DRIVE
MENLO PARK, CALIFORNIA 94025

© 2007 Tyco Electronics Corporation. All rights reserved

Revision : A
Date : 5/24/07
Page 1 of 2

Part Number : 202D253-XX-74
Description : Boot

Molded Parts Customer Drawing

Drawing Number : 20
Description : Boot


COMPATABILITY CHART

MATERIAL DASH NO.	MATERIAL DESCRIPTION	RT SPEC	COATING SLASH NO.	COATING S NO.	COATING DESCRIPTION
-25	Elastomer, Fluid Resistant	RT-1325	N/A		

ORDERING INFORMATION

Base part Description _____ 202D253 _____ /XXX -0
Material dash number _____ -25 _____
(See Compatibility Chart)
Modification number _____
Adhesive slash number _____
(If necessary, see Compatibility Chart)
Color Designator _____

THIS DRAWING IS SUBJECT TO CHANGE WITHOUT NOTICE; CONSULT YOUR
NEAREST FIELD REPRESENTATIVE FOR CURRENT REVISION



TYCO ELECTRONICS
300 CONSTITUTION DRIVE
MENLO PARK, CALIFORNIA 94025

© 2007 Tyco Electronics Corporation. All rights reserved

Revision : A
Date : 5/24/07
Page 2 of 2

Drawing Number : 20
Description : Boot

Looking for pricing, stock, or lifecycle information?

Click below to explore more details on WIN SOURCE:

 [View CC3909-000 on WIN SOURCE](#)

 [TE Connectivity](#) Information

Optimize Your Supply Chain with WIN SOURCE Solutions

-  Global Sourcing Solution
-  Obsolete Management
-  Cost Control Management
-  Shortage Management
-  Alternative Solution
-  Excess Inventory Management